



Product	PLUS grab bar, corner with vertical grip 30" x 17.9" x 42.9"
Item number	RT138112
Color	VVS:777568712 NRF:6311234 RSK:8980591 EAN:5708590318790 HMI: 25429 NBS:N13:436 FDA:ILS/D135866 Anthracite gray
Product description	<p>PLUS grab bars are high-quality products and they can be combined in countless ways and they provide the final touch to furnishing a functional and flexible bathroom. A reliable solution with many different options, which can easily lay the grounds for increased independence.</p> <p>PLUS grab bar combination, 1.3", reversible right/left, A:30" x B:17.9" x C: 42.9". Material: Powder-coated aluminium and plastic. Excl. mounting kit.</p>
Product capacity	Maximum load: 440 lbs. When the grab bar is loaded with 440 lbs, each wall fastener is loaded with 123 lbs. <i>Grab bars are tested with a 1.5 safety factor in accordance with the requirements in ISO 17966:2016.</i>
Materials	Core material: Aluminium Surface material: Polyester lacquer Cover cap: Cyclooy plastic Strap: Nylon (PA)
Ergonomy	The 1.3" diameter enables the rail to be held comfortably and firmly. The projection of 2" from the wall makes it easy to take hold of the rail.
Warranty	Pressalit makes a commitment to remedy material and manufacturing defects for a period of five years from the invoicing date.



Product	PLUS grab bar, corner with vertical grip 30" x 17.9" x 42.9"
Item number	RT138112
Cleaning	<p>This product should be cleaned with hot water or a mild cleaning solution. Do not use chlorine based, corrosive or abrasive cleaners as it may result in the surface being damaged.</p> <p>The following cleaning agents have been tested by Pressalit and may be used, as long as they are diluted according to the instructions on the container.</p> <p>DISINFECTANTS: Clinimax Difficil-S Erisan OXY+ Sprit (husholdningssprit) Suma Bac D10 Virkon Rodalon Desinfektionsspray Lysoformin Spezial CaviCide Sufanios Premium Tvättsprit 70%</p> <p>NON-DISINFECTANTS: Suma Star free D1 Taski 100 Taski 200 Milizid Citro</p> <p>The product must be wiped down with a soft rag wrung out in clear water immediately after cleaning, as some materials may otherwise be discolored and stained, and the surface coating may deteriorate.</p> <p>DECALCIFICATION OF ALUMINUM PARTS: Pressalit recommends that water deposits (Calcium, lime etc.) be removed from wall tracks and other aluminum parts using a solution of three parts of 30% acetic acid to seven parts tap water. When the aluminum parts have been washed down with this solution, the parts should be wiped over with a damp cloth wrung out in plain water.</p>








Product	PLUS grab bar, corner with vertical grip 30" x 17.9" x 42.9"
Item number	RT138112

Mounting in different wall types

	<p>Concrete >B25</p> <p>V8618 - Mounting kit, 16 bolts Ø5 x 50 - plugs SX8, for brick wall. Must be ordered separately.</p>	
	<p>Solid Brick >= Mz12</p> <p>V8618 - Mounting kit, 16 bolts Ø5 x 50 - plugs SX8, for brick wall. Must be ordered separately.</p>	
	<p>Solid Sand Lime Brick >= Hlz12</p> <p>V8618 - Mounting kit, 16 bolts Ø5 x 50 - plugs SX8, for brick wall. Must be ordered separately.</p>	
	<p>Aerated Concrete P4</p> <p>V8668 - Mounting kit, 16 bolts M5 x 50 - plugs FTP K 6, for aerated concrete. To be ordered separately.</p>	
	<p>Drywall (2 x 12,5 mm) water-resistant, re-enforced with wood</p> <p>V8618 - Mounting kit, 16 bolts Ø5 x 50 - plugs SX8. NB! Plugs are not needed. To be ordered separately.</p>	

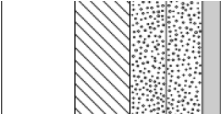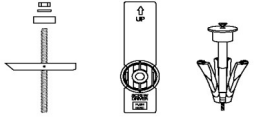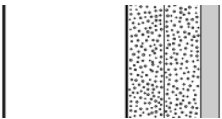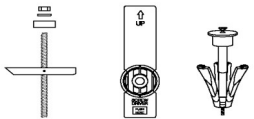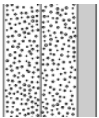

Product Item number	PLUS grab bar, corner with vertical grip 30" x 17.9" x 42.9" RT138112
	Drywall (2 x 12,5 mm) water-resistant, re-enforced with 22 mm plywood Wall fasteners (16 pcs) must be bought separately, for drywall it is possible to use e.g. SnapTight or Wingt anchors or similar. 
	Drywall (2 x 12,5 mm) water-resistant, re-enforced with steel plates (.08 inch) Wall fasteners (16 pcs) must be bought separately, for drywall it is possible to use e.g. SnapTight or Wingt anchors or similar. 
	Drywall (2 x 12,5 mm) water-resistant Mounting in this wall type is not recommended - risk of fatal injury to persons and walls. 