



PRESSALIT®

Product Item number	PLUS grab bar, 24" RT024000
Color	EAN:5708590333977 FDA:ILS/D135866 White
Product description	PLUS grab bars are ADA-compliant. PLUS grab bar, 24", diameter 1.3", for fixed mounting. ADA-compliant. The 1.3" outside diameter enables the grab bar to be held comfortably and firmly. The projection of 1.5" from the wall makes it easy to take hold of the grab bar. Inkl. wall rosette, which covers the fixings. Material: Powder-coated aluminium and plastic. Excl. mounting kit.
Product capacity	Maximum load: 440 lbs. When the grab bar is loaded with 440 lbs, each wall fastener is loaded with 123 lbs. <i>Grab bars are tested with a 1.5 safety factor in accordance with the requirements in ISO 17966:2016.</i>
Materials	Core material: Aluminium Surface material: Polyester lacquer Cover cap: Cycoloy plastic
Ergonomy	The 1.3" outside diameter enables the grab bar to be held comfortably and firmly. The projection of 1.5" from the wall makes it easy to take hold of.
Warranty	Pressalit makes a commitment to remedy material and manufacturing defects for a period of five years from the invoicing date.




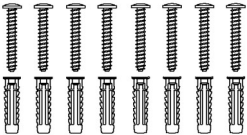
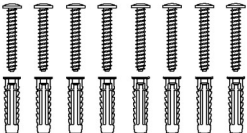

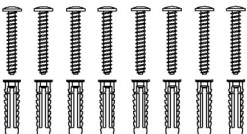



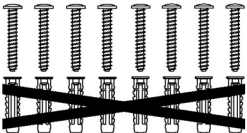
PRESSALIT®

Product	PLUS grab bar, 24"
Item number	RT024000
Cleaning	This product should be cleaned with hot water or a mild cleaning solution. Do not use chlorine based, corrosive or abrasive cleaners as it may result in the surface being damaged. The following cleaning agents have been tested by Pressalit and may be used, as long as they are diluted according to the instructions on the container. DISINFECTANTS: Clinimax Difficil-S Erisan OXY+ Sprit (husholdningssprit) Suma Bac D10 Virkon Rodalon Desinfektionsspray Lysoformin Spezial CaviCide Sufanios Premium Tvättsprit 70% NON-DISINFECTANTS: Suma Star free D1 Taski 100 Taski 200 Milizid Citro The product must be wiped down with a soft rag wrung out in clear water immediately after cleaning, as some materials may otherwise be discolored and stained, and the surface coating may deteriorate. DECALCIFICATION OF ALUMINUM PARTS: Pressalit recommends that water deposits (Calcium, lime etc.) be removed from wall tracks and other aluminum parts using a solution of three parts of 30% acetic acid to seven parts tap water. When the aluminum parts have been washed down with this solution, the parts should be wiped over with a damp cloth wrung out in plain water. Pressalit A/S, Pressalitvej 1, 8680 Ry, Denmark This grab bar is in compliance with ANSI A117.1-2009 with regards to outside diameter, spacing from the wall and structural strength. It can be installed both vertically and horizontally.








Product	PLUS grab bar, 24"
Item number	RT024000

Mounting in different wall types

	Concrete >B25 V8616 - Mounting kit, 8 bolts Ø5 x 50 - plugs SX8, for brick wall. Must be ordered separately. 
	Solid Brick >= Mz12 V8616 - Mounting kit, 8 bolts Ø5 x 50 - plugs SX8, for brick wall. Must be ordered separately. 
	Solid Sand Lime Brick >= Hlz12 V8616 - Mounting kit, 8 bolts Ø5 x 50 - plugs SX8, for brick wall. Must be ordered separately. 
	Aerated Concrete P4 V8666 - Mounting kit, 8 bolts M5 x 50 - plugs FTP K 6, for aerated concrete. To be ordered separately. 
	Drywall (2 x 12,5 mm) water-resistant, re-enforced with wood V8616 - Mounting kit, 8 bolts Ø5 x 50 - plugs SX8. NB! Plugs are not needed. To be ordered separately. 



PRESSALIT®

Product Item number	PLUS grab bar, 24" RT024000		
	Drywall (2 x 12,5 mm) water-resistant, re-enforced with 22 mm plywood Wall fasteners (8 pcs) must be bought separately, for drywall it is possible to use e.g. SnapTight or WingIt anchors or similar.		
	Drywall (2 x 12,5 mm) water-resistant, re-enforced with steel plates (.08 inch) Wall fasteners (8 pcs) must be bought separately, for drywall it is possible to use e.g. SnapTight or WingIt anchors or similar.		
	Drywall (2 x 12,5 mm) water-resistant Mounting in this wall type is not recommended - risk of fatal injury to persons and walls.		

pressalit.com